





Premium High Cut System Process Chart

For All Paint Systems (including the very latest energy or 'hyper' clearcoats)

Remove Defect



Inspect defect



Remove defect - P1500

Stage 1: CUT



G3 Premium Abrasive Compound

Product Size	Codes
500g	G3P506
1kg	G3P101

Applicators

G Mop 6" High Cut Foam
G Mop 8" High Cut Foam

Codes

GMC618
GMC818

Stage 2: FINISH (if desired)



G3 Premium Abrasive Compound

Product Size	Codes
500g	G3P506
1kg	G3P101

Applicators

G Mop 3" Finishing Foam
G Mop 6" Finishing Foam
G Mop 8" Finishing Foam

Codes

GMF301
GMF601
GMF801

Stage 1: CUT

-  Attach a G Mop Back Plate and a G Mop High Cut Foam to a polisher
-  Shake bottle well before use
-  Dispense a small quantity of product onto surface or pad

Tip: Prior to first use of a new pad, roughen with a Spurring Brush (1090005) to ensure optimum results. Clean pad with the Spurring Brush after use.

-  Compound at **LOW SPEED** 900 - 1300rpm
-  Wipe clean with a Finishing Cloth **FC-3** (3 x cloths)

The G Mop High Cut Foam is flexible which follows to contours of the bodywork providing a safe, powerful cut and high shine finish evenly.

Stage 2: FINISH (if desired on darker colours)

If swirl marks or holograms remain, use the same process as in Stage 1: **CUT** but with a G Mop Finishing Foam and a small quantity of G3 Premium at 800 - 1100rpm.

Applicator Back Plates

G Mop Flexible Back Plate for 6" Pads
GMB146 (14mm thread size)
GMB586 (5/8" thread size)
GMB166 (16mm thread size)

G Mop Flexible Back Plate for 8" Pads
GMB814 (14mm thread size)
GMB858 (5/8" thread size)
GMB816 (16mm thread size)



Stage 3: PROTECT



G3 Glaze Gloss Enhancer

Product Size	Codes
500ml	G3G501
1 ltr	G3G101
1 US gallon	G3G118

Applicators for both products

G Mop 3" Finishing Foam
G Mop 6" Finishing Foam
G Mop 8" Finishing Foam
Finishing Cloth (3 x cloths)

Codes

GMF301
GMF601
GMF801
FC-3

G3 Wax Premium Liquid Protection

Product Size	Codes
500ml	G3W501
1 ltr	G3W106
1 US gallon	G3W118

Stage 3: PROTECT - G3 Glaze (for fresh paint)

-  Attach a G Mop Back Plate and a G Mop Finishing Foam to a polisher
-  Shake bottle well and apply a small quantity to the pad
-  Polish at 800 - 1100rpm
-  Wipe clean with a Finishing Cloth **FC-3** (3 x cloths)

Stage 3: PROTECT - G3 Wax (for fully cured paint)

-  Shake bottle well and apply a small quantity to the surface or cloth
-  Rub the product in a circular motion onto the surface
-  Allow to dry to a haze
-  Wipe clean with a Finishing Cloth **FC-3** (3 x cloths)



G3 Premium TECHNICAL BENEFITS

ON ALL GLOSS PAINTS INCLUDING CERAMICS

- All new abrasive system for faster one-step and more consistent cut even on the hardest paints
- No die back/loss of gloss
- Clear emulsion allows user to see through residue to the surface
- No drying out. Advanced emulsion system ensures product works for longer - economical
- High gloss, low swirls
- Cut and ease of use further enhanced by high cut foam



WYATT MACHINE TOOLS

New Zealand's Leading Collision Repair Experts

www.wyatt.co.nz

388 Church St, Penrose, Auckland

info@wyatt.co.nz

Ph: 09 525 1000