



G3 Extra System Process Chart

For Medium Solids Paint Systems

Remove Defect

Inspect defect

Remove defect - P1500

1. Compounding

OR

G3 Extra
Abrasive Compound

Stage 1: CUT

Product Size	Codes
500g	G3E501
1kg	G3E101
1 US gallon	G3E118

Applicators

G Mop 8" Twisted Wool Pad - Single Sided	GMW801
G Mop 8" Twisted Wool Pad - Double Sided	GMW806
G Mop 8" Yellow Compounding Foam	GMC812

- ATTACH**
Attach a G Mop 8" Wool Pad to a polishing machine
- SHAKE**
Shake bottle well before use
- POUR**
Dispense a small quantity of product onto surface or pad
- 1500 - 1800rpm**
Compound at 1500 - 1800rpm
- Wipe clean with a Finishing Cloth FC-3 (3 x cloths)**

2. Finishing

G3 Fine
Finishing Compound

Stage 2: FINISH

Product Size	Codes
500g	G3F501
1kg	G3F101
1 US gallon	G3F118

Applicators

G Mop 3" Finishing Foam	GMF301
G Mop 6" Finishing Foam	GMF601
G Mop 8" Finishing Foam	GMF801

- ATTACH**
Attach a G Mop Finishing Foam to a polishing machine
- SHAKE**
Shake bottle well before use
- POUR**
Dispense a small quantity of product onto surface or pad
- 1000rpm**
Spread and start compounding at 1000rpm
- 2000rpm**
Slowly increase speed to 2000rpm. **DO NOT ALLOW PRODUCT TO DRY**
- Wipe clean with a Finishing Cloth FC-3 (3 x cloths)**

3. Protecting

OR

G3 Glaze
Glass Enhancer

Stage 3: PROTECT

Product Size	Codes
500ml	G3G501
1ltr	G3G101
1 US gallon	G3G118

G3 Wax
Premium Liquid Protection

Product Size	Codes
500ml	G3W501
1ltr	G3W106
1 US gallon	G3W118

Applicators for both products


G Mop 3" Finishing Foam	GMF301
G Mop 6" Finishing Foam	GMF601
G Mop 8" Finishing Foam	GMF801
Finishing Cloth (3 x cloths)	FC-3

G3 Glaze - Primary Application by machine

- ATTACH**
Attach a G Mop Finishing Foam to a machine
- SHAKE**
Shake bottle well and apply a small quantity to pad or surface
- 1000 - 1500rpm**
Compound at 1000 - 1500rpm
- Wipe clean with a Finishing Cloth FC-3 (3 x cloths)**

G3 Wax - Primary Application by hand

- SHAKE**
Shake bottle well and apply a small quantity to the surface
- RUB**
Rub the product in a circular motion onto the surface with a cloth
- HOZE**
Allow to dry to a haze
- Wipe clean with a Finishing Cloth FC-3 (3 x cloths)**

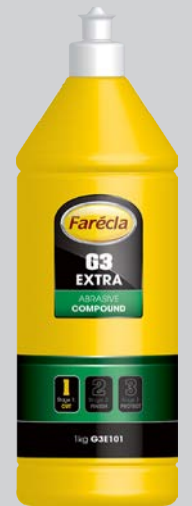

G3 Extra TECHNICAL BENEFITS

FOR MEDIUM SOLIDS PAINT SYSTEMS

- Removes P1500 or finer sanding marks
- Versatile compound - for use with wool or foam
- OEM suitable
- Restores oxidised paint-work and dull surfaces
- Low swirls



WYATT MACHINE TOOLS

New Zealand's Leading Collision Repair Experts

www.wyatt.co.nz

388 Church St, Penrose, Auckland

info@wyatt.co.nz

Ph: 09 525 1000